Electrical

Electrical Sundries

Crocodile Clips

For low voltage use. Spring loaded serrated jaws. With screw lead connection. Length approximately 40mm. Supplied in a pack of 10.

EE100-17 Clips

Wire, bare

For low voltage use. In reels. All data below is nominal.

	s.w.g.	Diameter mm	Reel weight, g				
Copper							
EE140-20	20	0.90	250				
EE140-22	22	0.71	250				
Constantan (Eu	Constantan (Eureka)						
EE147-20	20	0.90	125				
EE147-22	22	0.71	125				
Nickel Chromium (80%/20%)							
EE151-20	20	0.90	125				
EE151-22	22	0.71	125				
EE151-24	24	0.56	125				
EE151-26	26	0.45	125				
EE151-28	28	0.37	125				

Plug, UK 13A

Moulded plastic body with 3-pins, cable restrainer and 13A fuse. To BS1363. **EE300-10** Plug

Adapter plugs

Enable instruments with UK 13A 3-pin plugs to be operated from international supply sockets as indicated*. Maximum current 7.5A. Supplied singly.

2 round pin Schuko, for use in most continental

European countries

EE305-08 2 flat pin with angle adjustment, for use in USA*, Canada*, Japan*, Australia and New Zealand

Multiple Socket Outlet

4-position, UK 13A sockets to BS1363. With indicator lamp and 13A fuse.

EE330-10 Multi-socket

Digital Multi Meter 33XR

Pocket sized multi meter with LCD readout including analogue bar graph of reading position within range, rotary click-stop range selection switch, fuse protection, input alarm when test leads are incorrectly fitted and a continuity test buzzer for short circuit testing.

			<u> </u>
Model			33XR
Ca Ter	Voltage Voltage Current Resistance apacitance inperature Frequency	d.c. a.c. a.c.	400mV, 4V, 40V, 400V,1000V 400mV, 4V, 440V, 400V,750V 400 A, 4mA, 40mA, 300mA, 10A 400 , 40k , 4M 4 F, 40 F, 400 F, 4000 F -20 to +1000°C (-40 to +1832°F) 4kHz, 40MHz, 400MHz
Continuity indication			<35
Overall H	I x W x D	mm	196 x 92 x 60
Weight		g	400

As described. Supplied with test leads, threaded crocodile clips, Type K thermocouple probe and lead for temperature measurement and 9V PP3

EE390-50 33XR

BL610-25 Spare battery, 9V

Other Electrical Sundries

Batteries - see BL610. Hot air blower - see HE775. Soldering kit - see TS480.

Pliers - see TS200. Screwdrivers - see TS350. Warning labels - see SC300/SC304.



EE100




FF305-08



EE140/151

EE330

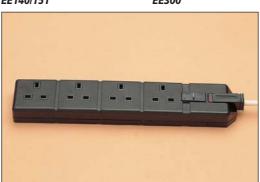



EE300



EE390



EE305-06



^{*} The instrument itself must have built-in voltage adjustment to enable operation on the local supply.